

## **IMPORTANT SAFETY RECALL NOTICE**

Öhlins TTX36 Shock absorbers	Date 2015-03-25	1(3)		
Robert Brinkmark	TTX36 MC aftermarket Shock absorbersOwners			

### Dear Customer

Öhlins Racing AB has discovered an assembly defect in certain batches and part numbers of aftermarket TTX36 (TTX GP, TTX RT & TTX36 MKII) MC shock absorbers.

Öhlins Racing AB has therefore decided to recall all the affected aftermarket TTX36 shock absorbers of the models and batches listed below to rectify the issue.

The cause for this defect is the piston-shaft nut which in some cases has not been torqued at full metal to metal contact because the top out spring is preventing the piston to reach its final position due to high friction.

Component assemblage shown in figure below.





### **IMPORTANT NOTICE!**

If the piston-shaft nut comes lose the result will be loss of damping and on some applicationsit can also cause the shock absorber to come apart. Either of these events may surprise the rider in a way that the rider no longer have full control of the motorcycle.

We therefore strongly urge you to stop using the bike until the shock absorber has been removed or corrected! It can be a safety issue to use the bike with the faulty shock absorber on the bike.

This assembly defect has been rectified and the issue does not exist on shock absorbers with an earlier or a later batch number.

We therefore ask you to contact an Öhlins service center to have the shock absorber corrected. Please visit <a href="http://www.ohlins.com/contact/distributors/">http://www.ohlins.com/contact/distributors/</a> alternatively contact us using the contact details below.

You will not bear any costs for this. Öhlins Racing AB will through us cover all costs related to removing and correcting the shock absorber.



### **INFORMATION**

TTX36 MC aftermarket Shock absorbersOwners	Date 2015-03-25	Page 2(3)

If you no longer are the owner of the bike with this shock absorber mounted, please provide us with information about the new owners, using the contact details below.

Batch numbers for the shock absorbers in question can be found below.

You can find the batch number on the shock absorber, stamped on the cylinder head, near the top mounting point.

If you chose to remove the shock absorber from the bike yourself, please ship it to us using the pre-paid address label. Don't forget to put your name and address information in the box. This is important for us so we can trace all claims.

If you have any further questions regarding this, please contact us using the contact details below.

We apologize for any inconvenience this safety recall may cause, but your safety is our first concern.

Yours sincerely

Öhlins Racing AB

Part No	Batchnu	mber(s)				
AP 340	136734	136735	137254	138061	309524	
BM 147	137936					
BM 340	136737	136739	137874	138320		
BM 342	136741	137875				
BM 343	136742	136920				
BM 345	309605					
BM 677	138736					
DU 339	309611					
DU 339P	137191	137494	309541			
DU 340	136743	136744	137149	137495	309528	
DU 868 (DU 871)	136527	138064				
HO 339	136745	136746	136747	309529	_	
HO 340	136749	136753	136754	137163	137593	309530
HO 358	137513	138121	309517	=		
KA 035	136126	137366	138068			
KA 040	137030	137735				
KA 336	136755	136756	137268	138613	309531	

# Öhlins Racing AB



## **INFORMATION**

Subject	Date	Page
TTX36 MC aftermarket Shock absorbersOwners	2015-03-25	3(3)

KA 338	136757	137741	309532	•						
KA 340	136758	136759	136760	136761	137031	137515	137822	137904	138293	309533
KA 358	137070									
KA 788	137518									
SU 026	137752	138791								
SU 339	136762	136763	137521	137753	309534	_				
SU 340	136764	136765	137522							
SU 357	309522									
SU 789	138770									
SU 932	137523									
TR 338	309584									
TR 339	136770	309536								
YA 339	136771	136772	136774	136775	136924	137185	137528	137933	309537	309610
YA 340	136776	136777	136778	137912	138631	309538				
YA 358	309519									
YA 359	309563									
YA 931	135517									